




S''' ; S' ; AS ;

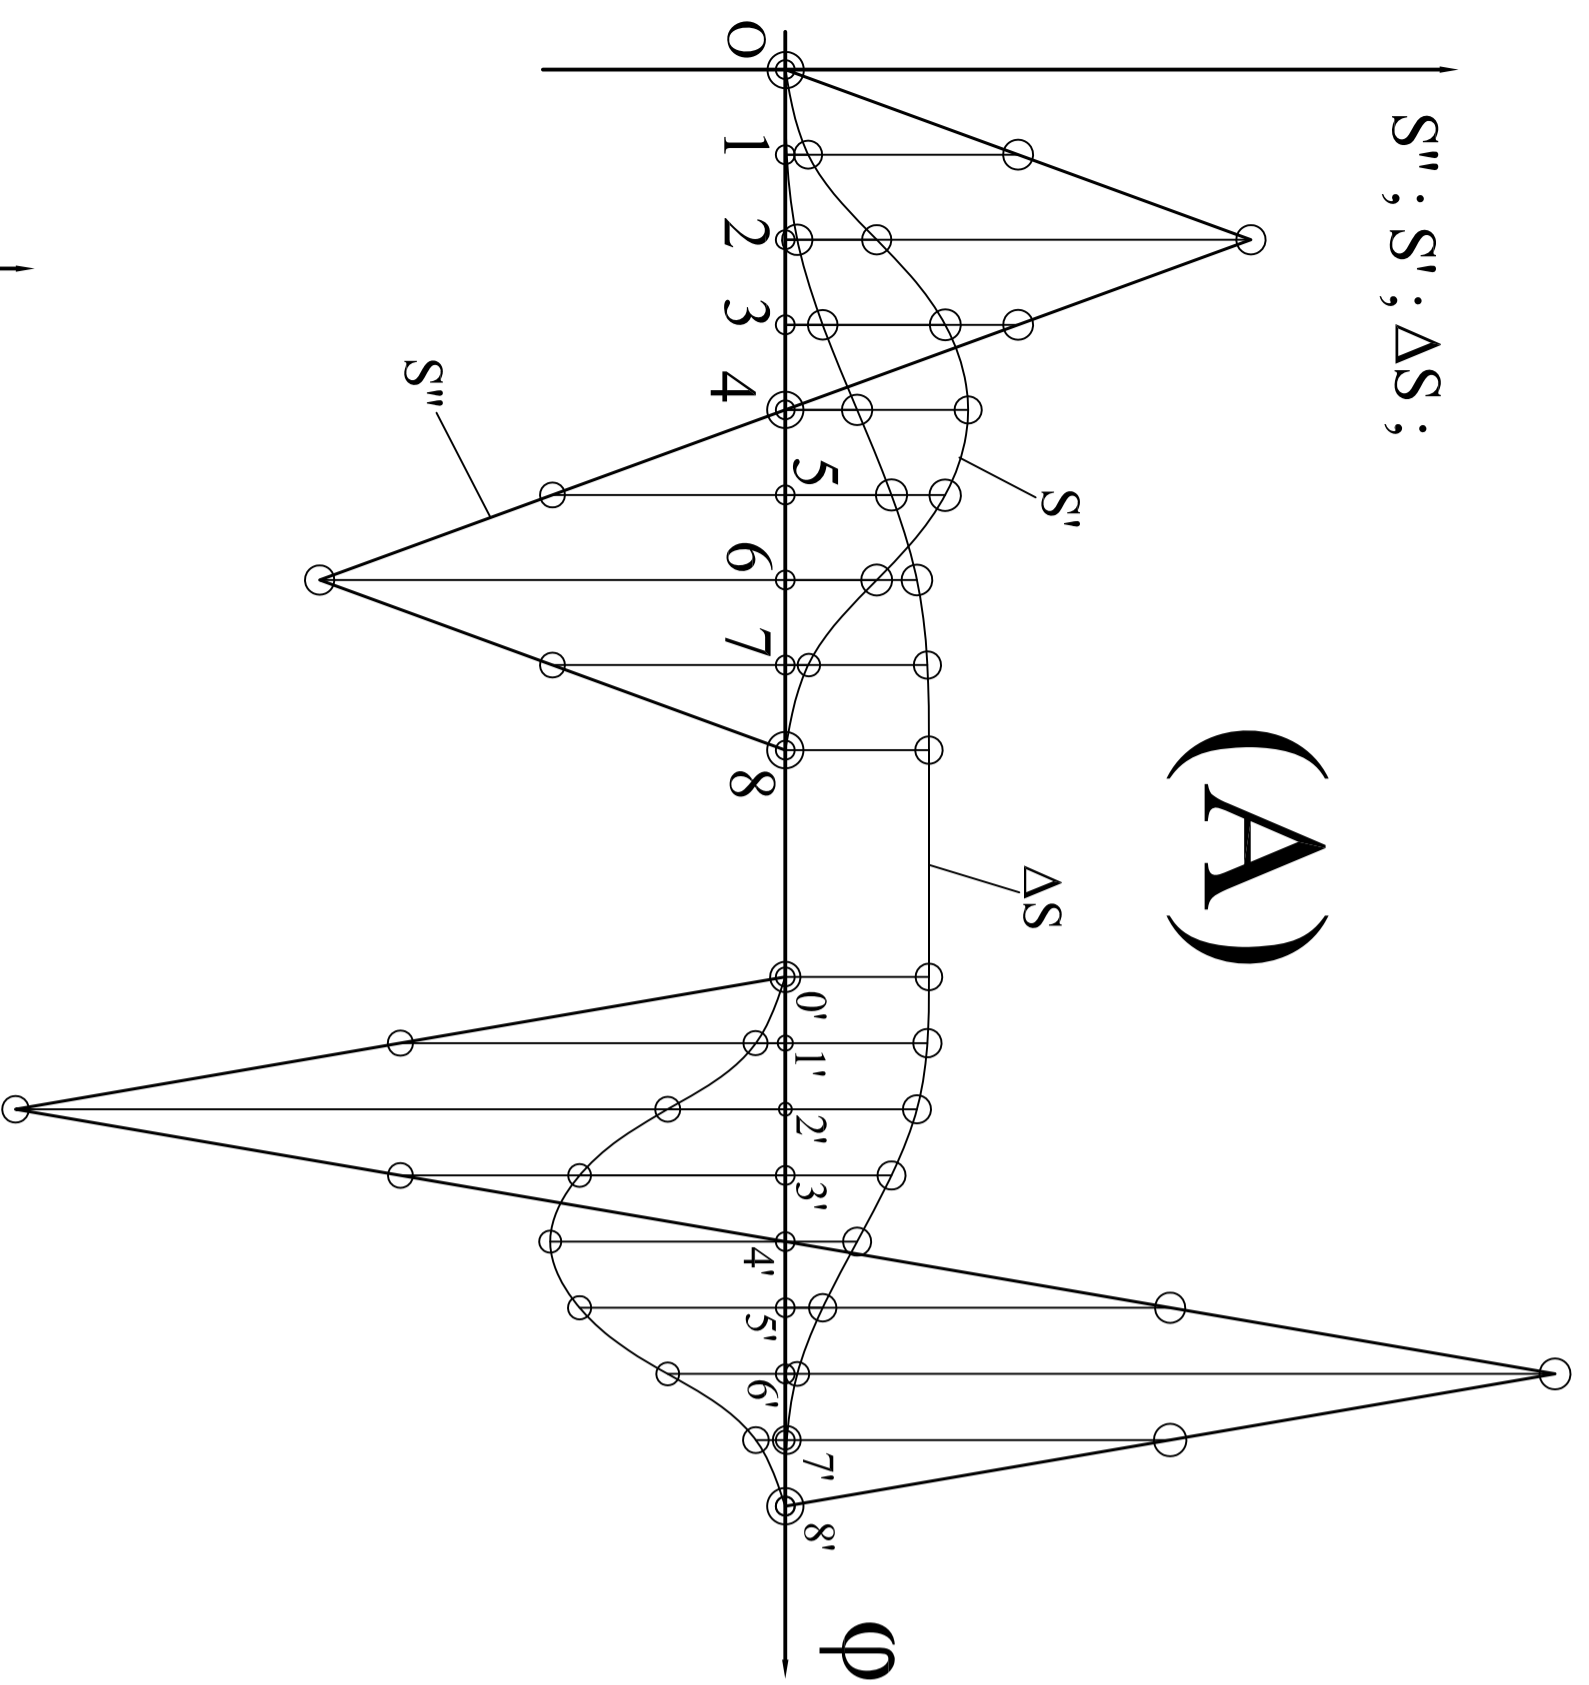


(A)

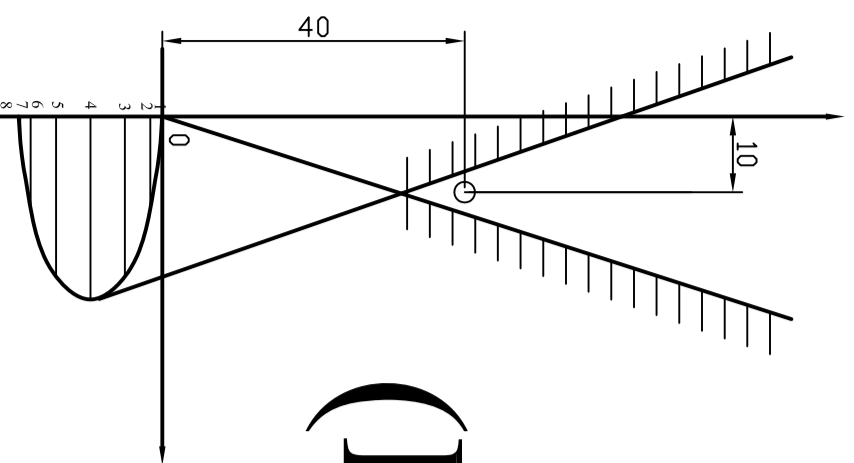

(B)

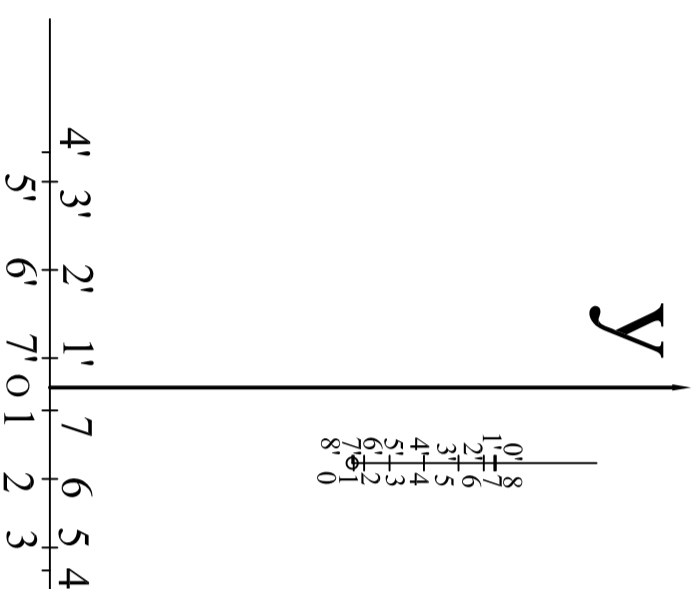

(B)

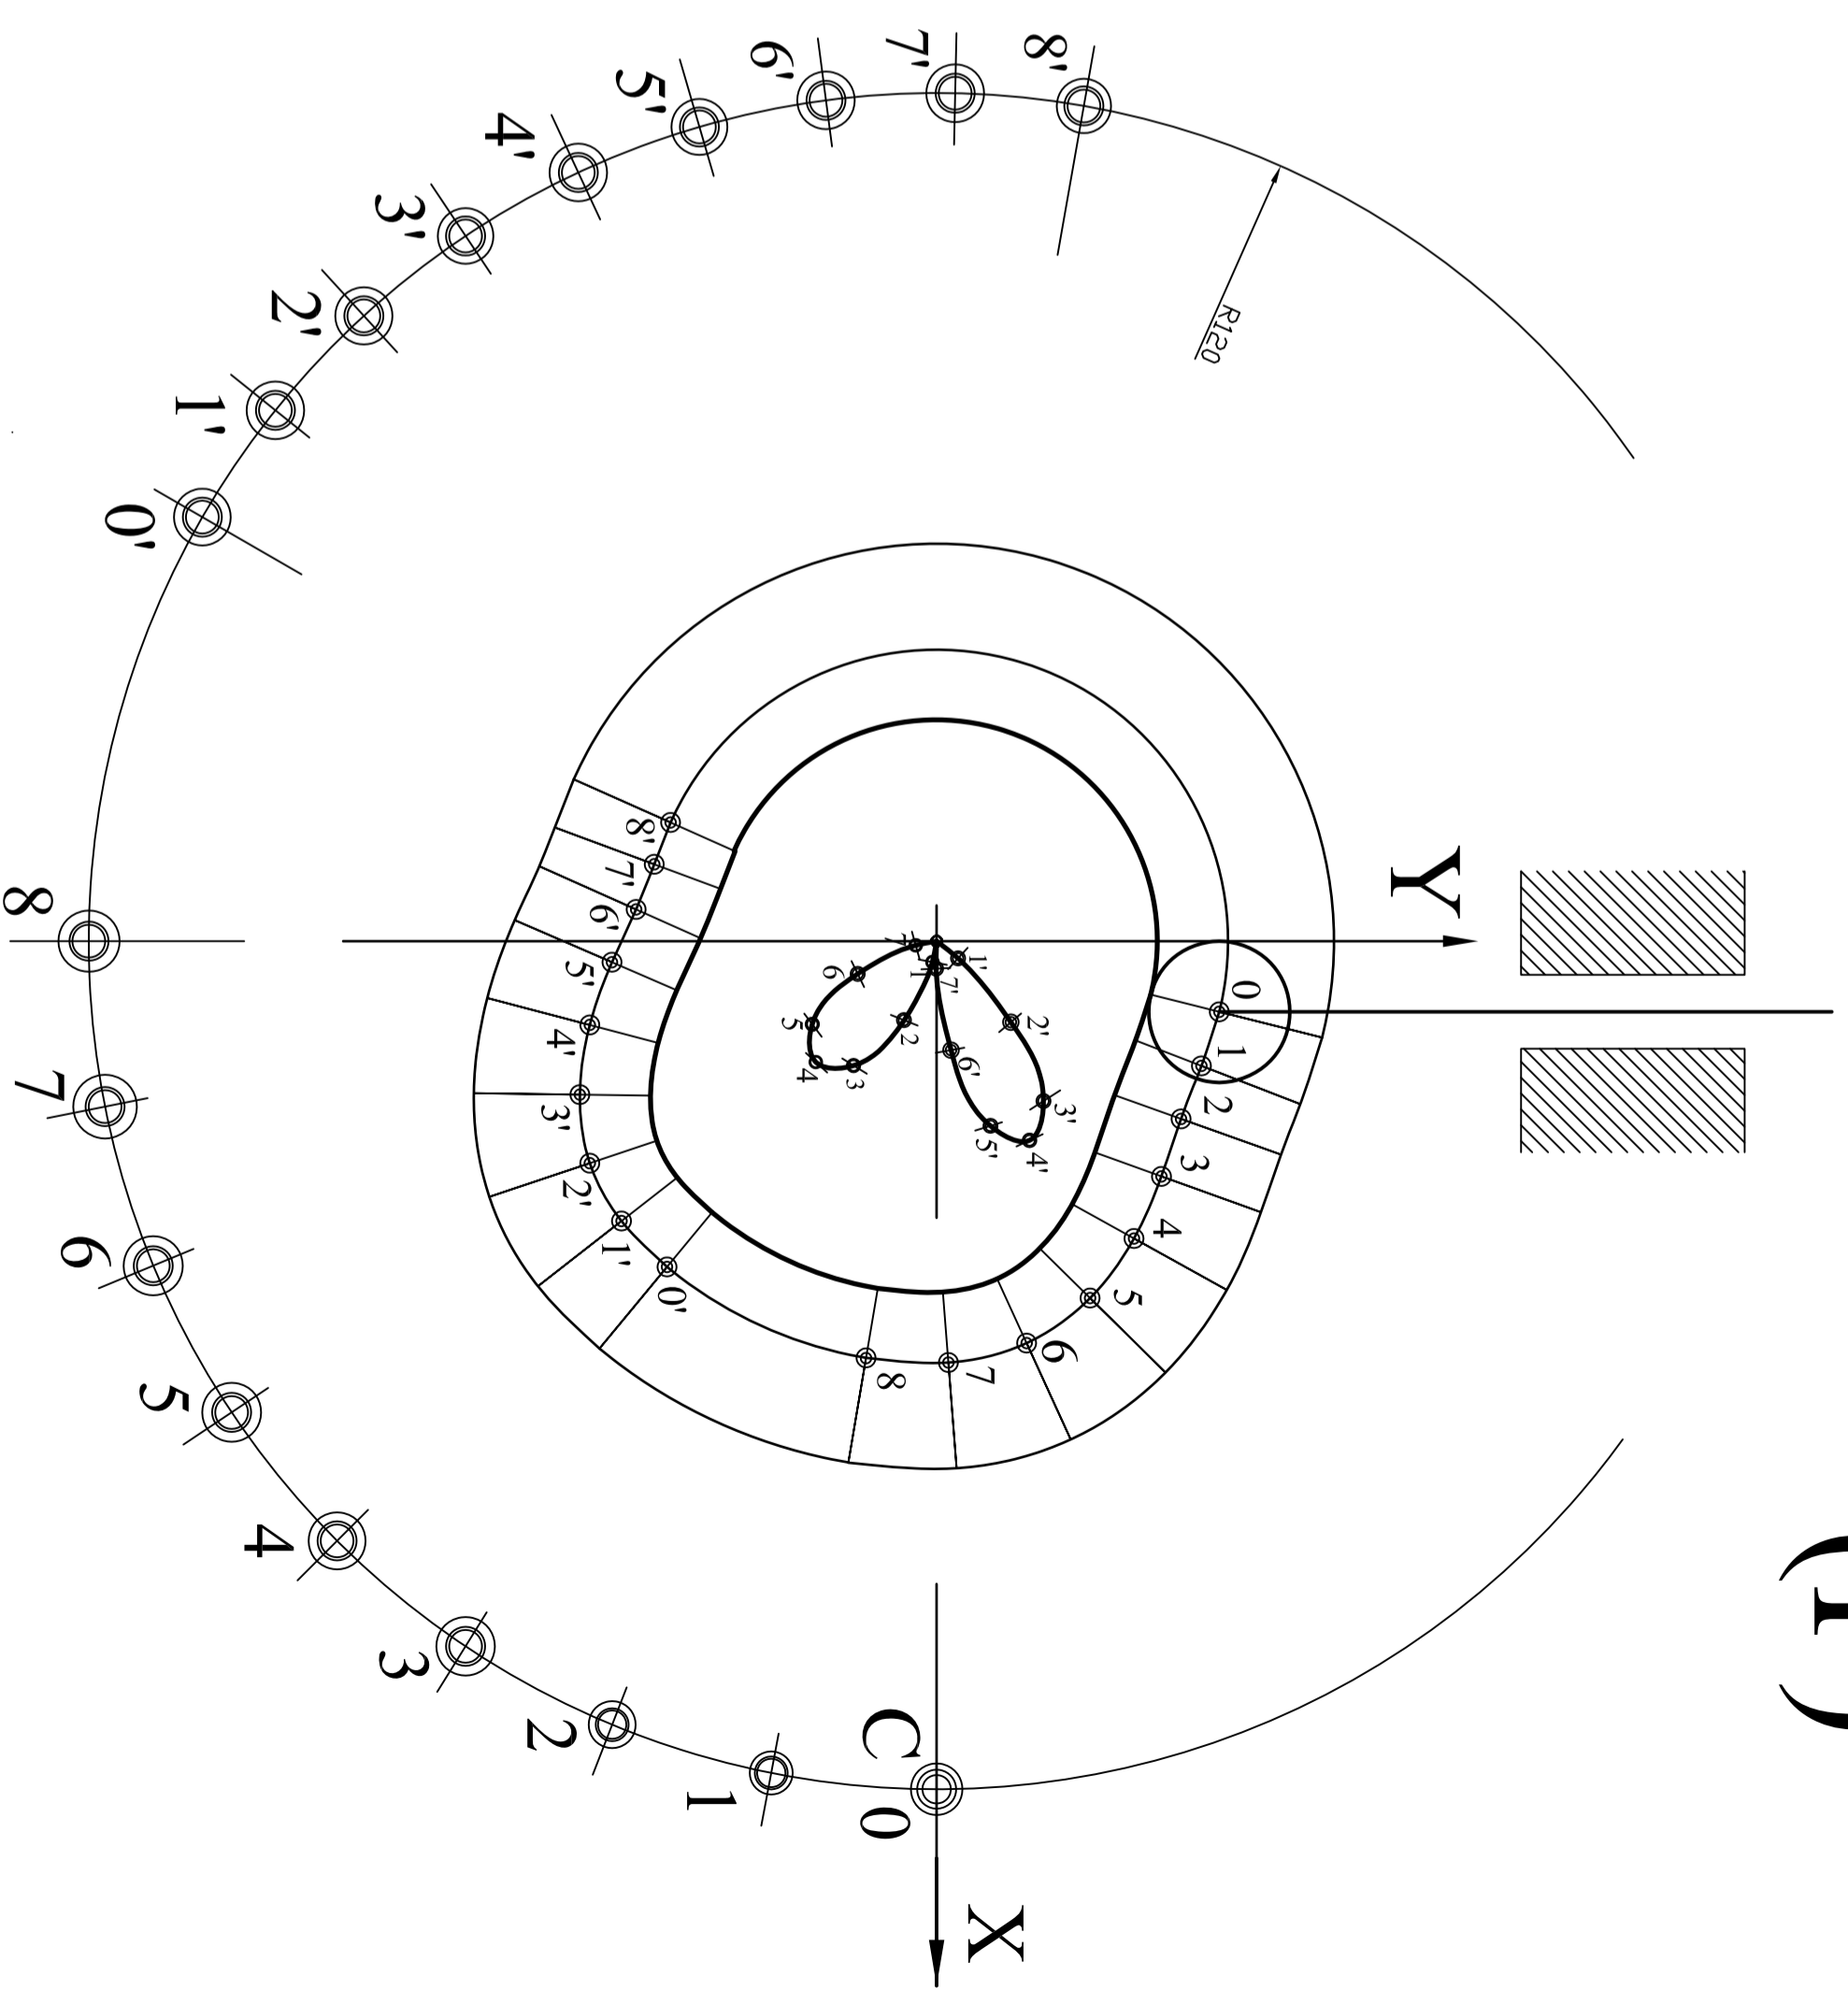

(Г)

N	"0"	"1"	"2"	"3"	"4"	"5"	"6"	"7"	"8"	0'	1'	2'	3'	4'	5'	6'	7'	8'
φ ₀	0	11,25	22,5	33,75	45,0	56,25	67,5	78,75	90,0	0	8,75	17,5	26,25	35,0	43,75	52,5	61,25	70,0
S'''	0	30,80	61,60	30,80	0	-30,80	-61,60	-30,80	0	0	-50,92	-101,83	-50,92	0	50,92	101,83	50,92	0
S'	0	3,02	12,10	21,17	24,19	21,17	12,10	3,02	0	0	-3,89	-15,55	-27,22	-31,10	-27,22	-15,55	-3,89	0
AS	0	0,20	1,58	4,95	9,50	14,05	17,42	18,80	19,00	19,00	18,80	17,42	14,05	9,50	4,95	1,58	0,20	0

Изм.	Ориг	Подпис	Дата
Разр.	Ступенчатые Точки		05.2009
Пров.	зв. ав. И. Милев		05.2009
Норм.			
Механизъм Гърбичен			
Масшаб		Маса	
1:1			
Лист			
1/1			
ТУ-София ; МФ ; Курс 2 ;			РП 05.00.00